AD-A200 430



A Comparison of Two Whole-Body Vibration Standards as Applied to Rotary-Wing Aircraft:

ISO 2631 vs ADS 27



Ву

Dennis L. Breen Barciay P. Butler

Biodynamics Research Division

July 1988

Approved for public release; distribution unlimited.

38 11 00 071

United States Army Aeromedical Research Laboratory Fort Rucker, Alabama 36362-5292

Notice

Qualified requesters

Qualified requesters may obtain copies from the Defense Technical Information Center (DTIC), Cameron Station, Alexandria, Virginia 22314. Orders will be expedited if placed through the librarian or other person designated to request documents from DTIC.

Change of address

Organizations receiving reports from the U.S. Army Aeromedical Research Laboratory on automatic mailing lists should confirm correct address when corresponding about laboratory reports.

Disposition

Destroy this document when it is no longer needed. Do not return it to the originator.

Disclaimer

The views, opinions, and/or findings contained in this report are those of the author(s) and should not be construed as an official Department of the Army position, policy, or decision, unless so designated by other official documentation. Citation of trade names in this report does not constitute an official Department of the Army endorsement or approval of the use of such commercial items.

Reviewed:

DANIEL W. GOWER, JR.

MAJ, MS

Director, Biodynamics Research

Division

J. /D. LaMOTHÉ, Ph.D.

COL, MS

Chairman, Scientific Review Committee Released for publication:

DAVID H. KARNEY Colonel, MC

Commanding

ਟਵ:	PIDITO	CLASCICIC	A TION OF	THIS PAGE
36	LURIIT	CEMPAINE	MILLON OF	INIS PAGE

REPORT I	OCUMENTATIO	N PAGE	Form Approved OMB No 0704-0188		
1a REPORT SECURITY CLASSIFICATION		16 RESTRICTIVE MARKINGS			
UNCLASSIFIED		NA			
2a SECURITY CLASSIFICATION AUTHORITY		3 DISTRIBUTION/AVAILABILITY OF REPOR			
2b. DECLASSIFICATION/DOWNGRADING SCHEDU	i C	Public release; distributi	on unlimited		
20. DECENSIFICATION DOWNGRADING SCHEDO	ce				
4. PERFORMING ORGANIZATION REPORT NUMBE	R(S)	5. MONITORING ORGANIZATION REPORT	NUMBER(\$)		
USAARL 88-11		ł			
6a. NAME OF PERFORMING ORGANIZATION U.S. Army Aeromedical	6b. OFFICE SYMBOL (If applicable)	7a NAME OF MONITORING ORGANIZATION U.S. Army Medical Research and Development			
Research Laboratory	SGRD-UAD-IV	Command	and beveropment		
6c. ADDRESS (City, State, and ZIP Code)		7b. ADDRESS (City, State, and ZIP Code)			
P. O. Box 577					
Fort Rucker, AL 36362-5292		Fort Detrick, Frederick, MI	21701-5012		
8a. NAME OF FUNDING, SPONSORING	8b. OFFICE SYMBOL	9 PROCUREMENT INSTRUMENT IDENTIFICA	ATIONI NILINADED		
ORGANIZATION	(If applicable)	PROCUREMENT INSTRUMENT IDENTIFICA	THOIR INCIDIBER		
		}			
8c. ADDRESS (City, State, and ZIP Code)	<u> </u>	10 SOURCE OF FUNDING NUMBERS			
		PROGRAM PROJECT TASK ELEMENT NO NO NO	WORK UNIT ACCESSION NO		
			1 1		
11 TITLE (Include Security Classification)		62787A 3E162787A878 AI	132		
A comparison of two whole-body	vibration stand	ards as applied to rotary-wir	o aircraft:		
ISO 2631 vs ADS-27 (U)	VIDIACION SCANO	arus us appried to rotary with	, g ulliciali.		
12. PERSONAL AUTHOR(S)					
Dennis L. Breen and Barclay P.		· 			
13a. TYPE OF REPORT 13b. TIME CO	OVERED TO	14 DATE OF REPORT (Year, Month, Day) 1988 July	5 PAGE COUNT 32		
Final FROM		1986 July	32		
70. 30. CEMENTAN NO PANON					
17. COSATI CODES	18 SUBJECT TERMS (Continue on reverse if necessary and identify	y by block number)		
FIELD GROUP SUB-GROUP		ration, signatures, standards			
20 11	assessment, co	omparison, ADS-27, ISO 2631, U	JH-60, UH-1,(*)		
19. ABSTRACT (Continue on reverse if necessary	and identify by block n	umber)			
Two whole-body vibration (WBV)	standards. Inte	rnational Standards Organiza	cion (ISO) 2631 and		
Aeronautical Design Standard 27					
UH-1 and UH-60 helicopters. ISO 2631 is a widely used WBV standard which accounts for vari-					
ables such as intensity, durati					
orthogonal directions. ADS-27 is a newer standard developed at the U.S. Army Aviation Sys-					
tems Command (AVSCOM) for measuring WBV produced by rotary-winged aircraft. An analysis of the two vibration signature types shows when vibration levels are measured on a pass/lall					
performance criteria, the ADS-27 becomes the more stringent standard; however, ADS-27 fails					
to answer the important health hazard questions that ISO 2631 attempts. ISO 2631 vibration					
acquisition techniques were found to be more scientifically sound than those proposed by the					
ADS-27. The use of both standards may prove to be a more complete method of helicopter					
WBV assessment					
					
20 DISTRIBUTION / AVAILABILITY OF ABSTRACT 22 UNCLASSIFIED/UNLIMITED SAME AS R	OT [7]	21 ABSTRACT SECURITY CLASSIFICATION	i		
22a. MAME OF RESPONSIBLE INDIVIDUAL	PT DIE USERS	والمراقب وال			
Chief Coientific Information	· · · · · · · · · · · · · · · · · · ·	22b TELEPHONE (Include Area Code) 22c OFFICE SYMBOL			

Table of contents

Pag	le
List of figures	L
List of tables 2	?
Introduction	j
Methods Data acquisition Data analysis ISO 2631 method of WBV analysis ADS-27 method of WBV data analysis Vibration transmission of seating system	1 7 9 L
Results)
Discussion	l.
Conclusions 23	}
References 24	ŀ
List of equipment manufacturers 25	;
List of figures	
Figure	je
 Triaxial accelerometers positioned to transmit vibration signals from seat pad location 	5
 Triaxial accelerometers positioned to transmit vibration signals from seat pan location 	5
3. Triaxial accelerometers positioned to transmit vibration signals from floor location	; >
4. Vibration data acquisition diagram 6	,



Data analysis diagram.....

Data acquisition system.....

5.

List of figures (continued)

Figure	9	Page
7.	ISO 2631 8-hour FDP curve limit, vertical axis	10
8.	ISO 2631 8-hour FDP curve limit, longitudinal and lateral axes	11
9a.	UH-60 seat pad power spectrum: X-axis	12
9b.	UH-60 seat pad power spectrum: Y-axis	12
9c.	UH-60 seat pad power spectrum: Z-axis	13
10a.	UH-1 seat pad power spectrum: X-axis	13
10b.	UH-1 seat pad power spectrum: Y-axis	14
10c.	UH-1 seat pad power spectrum: Z-axis	14
11.	ADS-27 normalization curves	15
12.	Intrusion index equation	16
13.	Frequency response graph, UH-60, between pad and pan locations, Z-axis	18
14.	Frequency response graph, UH-1, between pad and pan location, Z-axis	19
	List of tables	
Table		Page
1.	Test conditions for UH-60 and UH-1	. 8
2.	<pre>Intrusion index and 1BP frequency limits for flight regions 1 and 2</pre>	. 17
3.	Percentage of acceptable WBV signatures	. 20
4	Average intrugion index	20

Introduction

There have been efforts to measure the degrading effects of whole-body vibration (WBV) on crewmembers of rotary-wing aircraft (Kidd, 1981). The various measurement and analytic techniques currently in use emphasize different aspects of the vibration signatures. However, an ideal technique used to assess the effects of WBV would need to be flexible enough to describe a great number of vibration signatures as well as provide a level indicator intended to determine vibration magnitudes that either present a health risk or act as a hindrance to normal flight performance. Such a technique also must indicate flight duration constraints for factors that include flight mission profiles, crewmember position, and types of aircraft. This report explores two standards that attempt to meet these goals, the International Organization of Standards 2631 (ISO 2631) and the Aeronautical Design Standard 27 (ADS-27).

ISO 2631 and ADS-27 present two different methods of measuring and interpreting the WBV produced by rotary-wing aircraft. ISO 2631 is a widely used WBV standard that can be adjusted for vibration measures on both ground vehicles and rotary-wing aircraft. ISO 2631 accounts for WBV variables such as intensity, duration, frequency, range and vibration in all three orthogonal directions (X, Y, Z axis), and relates these variables to conditions involving crewmember comfort, performance capabilities, and risk to health. Though it has been criticized (Oborne, 1983) for a lack of scientific foundation, ISO 2631 has been somewhat effective in quantifying the WBV levels experienced by the pilot, copilot, and crewmembers of Army helicopters.

ADS-27, a newer WBV standard developed at the U.S. Army Aviation Systems Command (AVSCOM), is applicable specifically to measures of WBV produced by rotary-wing aircraft. ADS-27 quantifies this WBV by obtaining a statistical measure of the harmonic peaks as seen in the power spectrum of a rotary-wing aircraft. An adequate comparision of ISO 2631 and ADS-27 would require that both standards set numeric limits above which the quantified WBV level produced is said to fail.

The objectives of this study were to determine the fundamental differences between WBV standards ISO 2631 and ADS-27 and to explore the usefulness of implementing both standards in future health hazard assessments (HHA) of Army rotary-wing aircraft.

<u>Methods</u>

Data acquisition

WBV signatures were collected from two different Army helicopter types: the UH-60, a twin-engined four-bladed system, and the UH-1, a single engine, two-bladed system. Triaxial accelerometers were positioned to transmit vibration signals from the following six locations: directly on top of the pilot and copilot seats (referred to as the "seat pad" locations) (Figure 1), hard-mounted to the underside of the pilot and copilot seats (referred to as the "seat pan" locations) (Figure 2), and hard-mounted to the helicopter frame directly beneath the pilot and copilot seats (referred to as the "floor" location) (Figure 3). The seat pad triaxial accelerometers (B & K model 4322*) were mounted in flat, flexible rubber disks approximately 12 inches in diameter, taped to that portion of the seat cushion in direct contact with the pilot or copilot and, therefore, measured vibration transferred directly from the helicopter seating system to the pilot or copilot. The seat pad location was specified by ISO The seat pan triaxial accelerometers (B & K model 2631. 4321*) measured the input vibration to the pilot or copilot seat cushion. Seat pan transducer locations were specified by ADS-27. Hard-mounted floor accelerometers (B & K model 4321) were used to pick up the helicopter frame vibration, or that vibration considered to be the input to the pilot and copilot seating systems.

Helicopter vibration signals in the X-, Y-, and Z-axis of motion are transmitted from the piezoelectric triaxial accelerometers*, amplified by Kistler model 5041BM01 charge amplifiers* and recorded on TEAC HR-30 portable analogue cassette recorders*. The TEAC HR-30 is a 7-channel record-only device with a frequency response range from 0.5 to 1250 Hz, limited by a tape recording speed of 4.8 cm/s. These recorders generate a frequency which compensates for noise in recorded signals. To allow for a proper signal-to-noise ratio, the portable recorders were set to an input range of ± 1 volt. One of the recorder channels was used as a voice monitor for documentation. High quality analogue 7-channel cassettes were used for the vibration data acquisition phase (Figures 4 and 5).

^{*} See manufacturers' list.

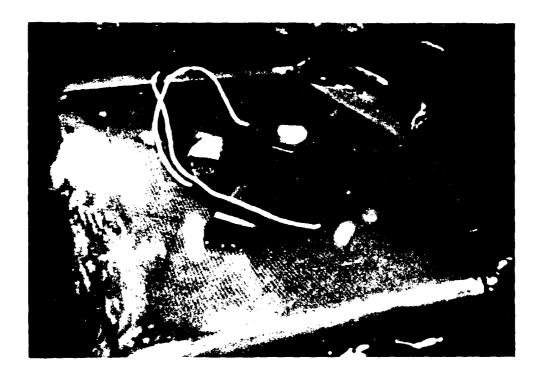


Figure 1. Triaxial accelerometers positioned to transmit vibration signals from seat pad location.



Figure 2. Triaxial accelerometers positioned to transmit vibration signals from seat pan location.



Figure 3. Triaxial accelerometers positioned to transmit vibration signals from floor location.

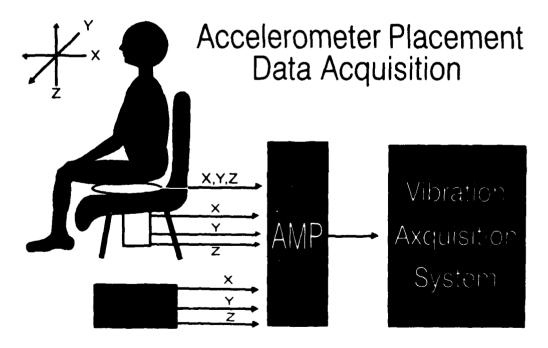


Figure 4. Vibration data acquisition diagram.

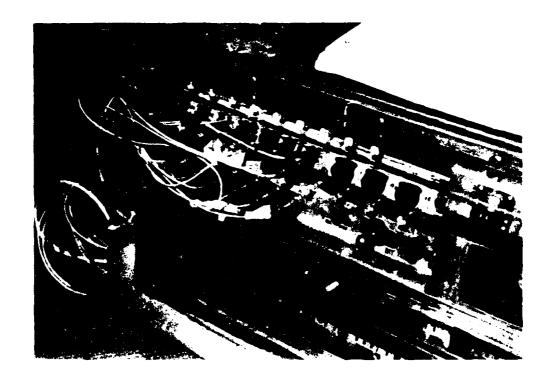


Figure 5. Data acquisition system.

Vibration signatures were taken for both the UH-60 and the UH-1 for a modified version of the flight profile shown in Table 1, provided by ADS-27.

Data analysis

The same recorded WBV signals were played back on a TEAC model MR-30 14-channel recorder/player* into two different signal analyzers. A Larson Davis RTA 1/3 octave analyzer* was used for the ISO 2631 method of vibration analysis, and a Dynamic signal analyzer* was used for the ADS-27 standard method for the analysis of vibration (Figure 6).

Table 1
Test conditions for UH-60 and UH-1

Trial	Manuver	Airspeed	Altitude	Duration
1	Hover IGE	0.00	5 ft	2 min
2	Hover OGE	0.00	50 ft	2 min
3	Hover, pedal, rt	0.00	50 ft	30 sec
4	Hover, pedal, lt	0.00	50 ft	30 sec
5	Forward flt	0.10(Vh)	runway	30 sec
6	Forward flt	0.40(Vh)	runway	30 sec
7	Rearward flt	limit	runway	30 sec
8	Left sideward	0.33 V(lim)	runway	30 sec
9	Right sideward	0.33 V(lim)	runway	30 sec
10	RPM sweep	0.90 Vh .96%		30 sec
11	RPM sweep	0.90 Vh .98%		30 sec
12	RPM sweep	0.90 Vh 1.0%		30 sec
13	Forward flt	0.50 Vh		2 min
14	Forward flt	0.90 Vh		2 min
15	Forward flt	1.00 Vh		2 min
16	Approach flare	rapid 70 kias		
17	Approach flare	slow 35 kias		
18	Unmask		5-35 ft	
19	Mask		35-5 ft	
20	Left turn 15/30°		100 ft	2 min
21	Left turn 30/60°		100 ft	2 min
22	Right turn 15/30°			2 min
23	Right turn 30/60°			2 min
24	Climb			
25	Descent			
26	Vcruise			2 min
27	Vmaximum			2 min
28	Hover IGE		5 ft	2 min
29	Hover OGE		35 ft	2 min
30	Vcruise			2 min
31	Vmaximum			2 min
32	Hover IGE			2 min
33	Hover OGE			2 min

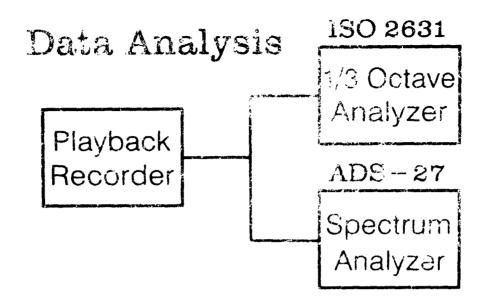


Figure 6. Data analysis diagram.

ISO 2631 method of WBV analysis

WBV translated directly to the pilot, copilot, and crewmembers was measured in terms of root mean square acceleration magnitudes contained in third-octave bands covering a frequency range from 1 to 80 Hz. The Larson Davis 3100 third-octave analyzer* measured the recorded vibration signals and derived magnitudes for all 20 third-octave bands, all flight conditions, and all 3 orthogonal axes of motion. The 8-hour fatigue decreased proficency (FDP) curve was used as a limit "not to exceed" for the comparison of the two standards. This 8-hour FDP curve is used to determine acceptable vibration levels during the SHA of Army tactical ground vehicles and rotary-wing aircraft. Third-octave levels then were compared to their corresponding ISO 2631 8-hour FDP curve acceleration limits. Conditioned WBV signatures either fell above or below the 8-hour curve FDP limit yielding a respective "unacceptable" or "acceptable" vibration level for that particular flight condition and accelerometer location. All 20 third-octave measurements for all three axes of motion were required to fall under the ISO 2631 8-hour FDP curve limit for that flight condition and accelerometer location to yield an "acceptable" level of WBV.

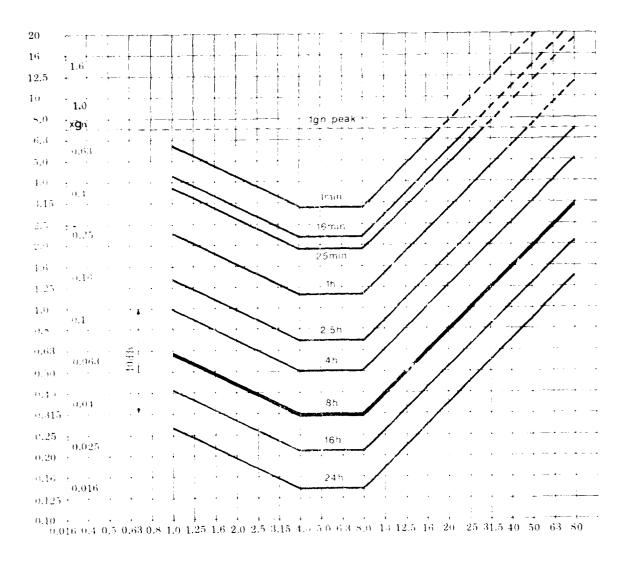


Figure 7. ISO 2631 8-hour FDP curve limit, vertical axis.

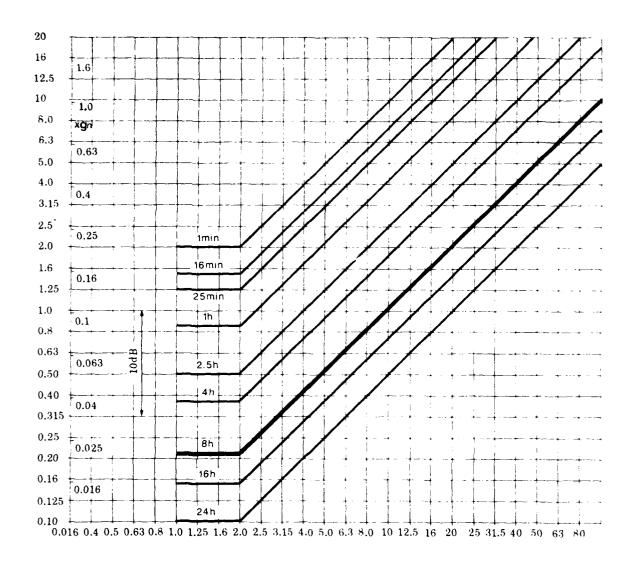


Figure 8. ISO 2631 8-hour FDP curve limit, longitudinal and lateral axes.

ADS-27 method of WBV data analysis

The Hewlett-Packard (HP) 3562 dynamic signal analyzer* is used to obtain a fast fourier transform power spectrum display of WBV signatures for each of the three orthogonal axes of motion, accelerometer position, and flight condition (Figures 9 and 10). A power spectrum displays the discrete sinusoid vibration peaks produced by all types of rotary-wing aircraft. These discrete frequency peaks, lying within the ADS-27 targeted frequency range (0 to 60 Hz), were used to derive a statistical matrix of the WBV produced by each flight condition.

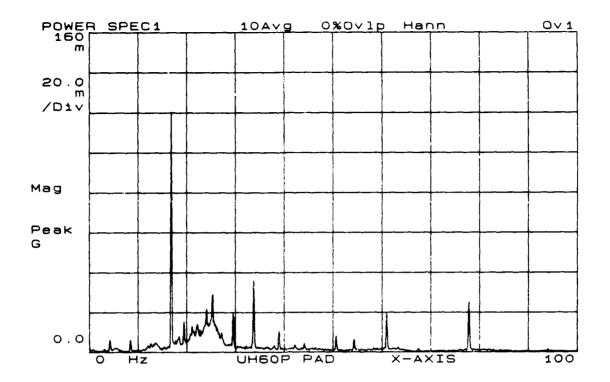


Figure 9a. UH-60 seat pad power spectrum, X-axis.

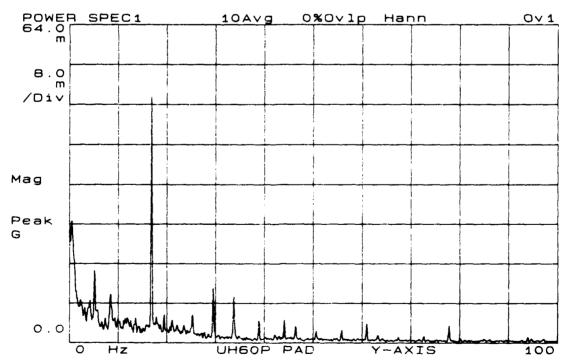


Figure 9b. UH-60 seat pad power spectrum, Y-axis.

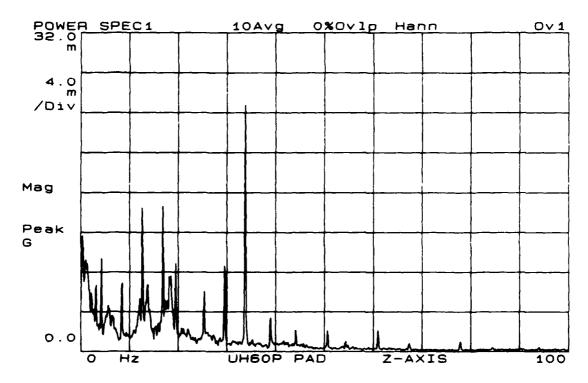


Figure 9c. UH-60 seat pad power spectrum, Z-axis.

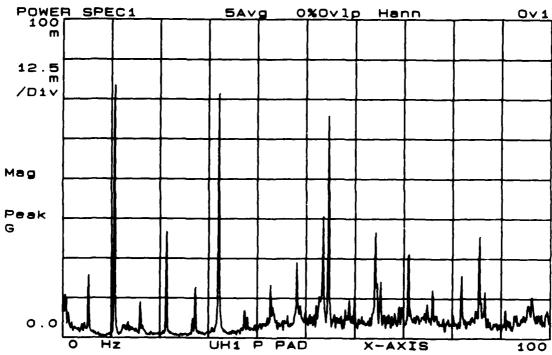


Figure 10a. UH-1 seat pad power spectrum, X-axis.

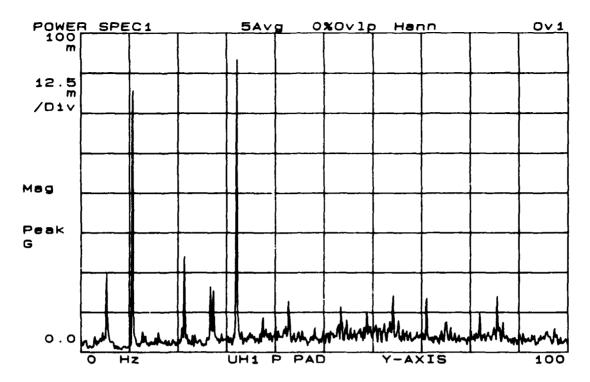


Figure 10b. UH-1 seat pad power spectrum, Y-axis.

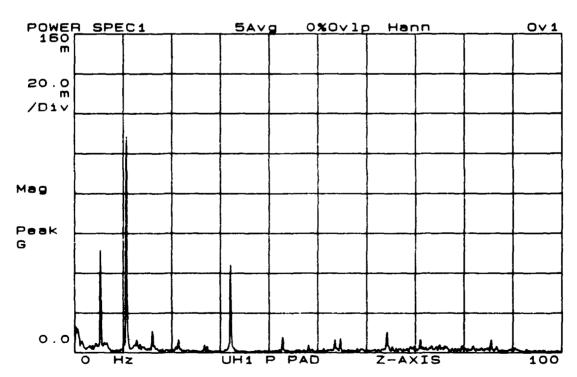


Figure 10c. UH-1 seat pad power spectrum, Z-axis.

This matrix, called an "intrusion index," is calculated by the following process, according to ADS-27: The four largest acceleration peaks, 60 Hz and below, excluding the first blade passing frequency (1BP) (acceleration peak produced by the helicopter's main rotor rpm), for the three normalized vibration spectra shall be identified, converted to a velocity measure, and squared. In Figure 11 can be found the normalization curves used to weigh each power spectrum. The 12 resulting squared values then shall be summed and the square root of that sum calculated (Figure 12). This numeric value is the intrusion index for that particular flight condition and accelerometer location. The intrusion index then is compared to a limit whereby an acceptable or unacceptable rating is derived.

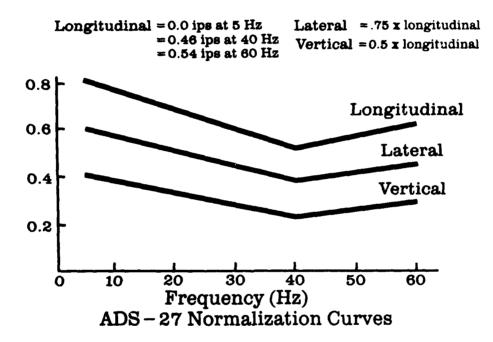


Figure 11. ADS-27 normalization curves.

Intrusion Index

Square Root Sum Of Squares

$$I.I. = \sqrt{\frac{\frac{4}{2}X_{n}^{2} + \frac{4}{2}Y_{n}^{2} + \frac{4}{2}Z_{n}^{2}}$$

Figure 12. Intrusion index equation.

Under ADS-27, flight conditions fall into four regions. Intrusion index limits are specified for all four regions.

Additionally, ADS-27 uses a limit on the 1BP magnitude for each axis of vibration and flight condition (Table 2). This 1BP limit is used by ADS-27 as a separate criteria. The 1BP limits also vary according to the four flight regions. For instance, if the 1BP magnitude in one of the three axes of motion exceeds the 1BP limit, that flight condition will receive an "unacceptable" WBV rating.

Table 2 Intrusion index and 1BP frequency limits for flight regions 1 and 2

Pilot

Flight Conditions	Intrusion Index	1BP (IPS)
Region I	1.2	.15
Region II	3.0	.3

Regions 1 and 2 were the only two regions used for this test and will, therefore, be defined here according to ADS-27:

"Region 1 consists of all steady flight conditions with load factors between 0.75 and 1.25 G and airspeeds from hover to normal cruising velocity and to the maximum rearward and sideward flight speeds, while operating within the defined power-on rotor speed limits. Within Region 1 the rotorcraft, aircrew, and all subsystems and equipment must meet the operational performance specifications."

"Region 2 consists of all flight conditions and maneuvers outside of Region 1 which have a duration of greater than 3 seconds. Subsystems and equipment should not incur damage which would result in a lower service life than required during exposure to Region 2 vibrations and must meet their operational performance specifications after exposures of any duration which might be encountered operationally."

Vibration transmission of seating system

To determine the vibration differences between the seat cushion and the seat frame, TEAC MR-30 14-channel recorder/player* and HP 3562A dynamic signal analyzer* were used to obtain a frequency response between seat pan and seat pad accelerometer locations. Frequency responses were used to yield gain and phase differences between input and an output vibrating elements. The input element was the seat pan and the output element was the seat pad. The HP 3562A is configured with channel 1 as the input and channel 2 as the output. Z-axis frequency responses (Figures 13 and 14) were measured during each flight condition for both UH-1 and UH-60 and plotted on a dB versus frequency graph at a frequency range of 1-100 Hz (Figures 9 and 10).

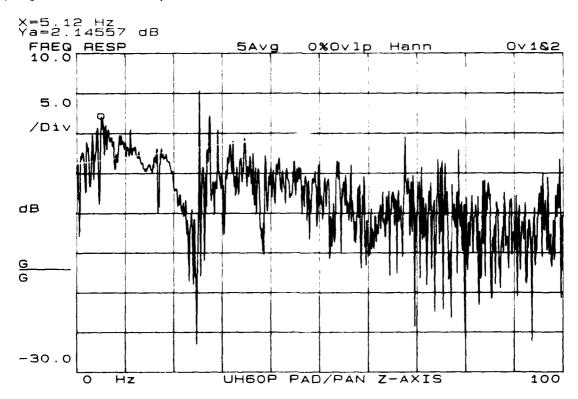


Figure 13. Frequency response graph, UH-60, between pad and pan locations, 2-axis.

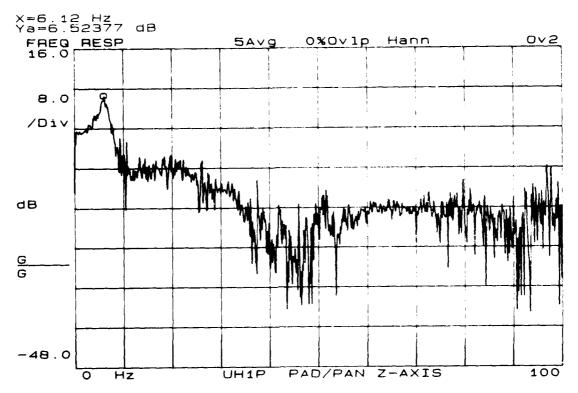


Figure 14. Frequency response graph, UH-1, between pad and pan locations, Z-axis.

Results

Vibration signatures from profiled flight conditions for the UH-1 and UH-60 were analyzed using the ADS-27 and the ISO 2631 WBV standards. Table 3, which presents a percent to pass table of acceptable WBV signatures, was developed for each helicopter type, flight condition, and accelerometer location using both ADS-27 and ISO 2631 methods. Table 3 presents the two ADS-27 criteria: the intrusion index and the 1BP. first column displays the percentage of acceptable vibration signatures that have been compared with the intrusion index criteria alone and the second column displays the acceptance percentage for vibration signatures that have been assessed using both the intrusion index and 1BP criteria. This combined criteria is denoted as *1BP. Column 3 displays the acceptance rate for the ISO 2631 criteria. The "Total" category denotes the total number percentage of vibration readings taken for that helicopter type. The "Pan" and "Pad" categories denote the total vibration readings taken from the seat pans or seat pads of that aircraft type; similarly, the categories "Co-P" and "P" denote the total vibration readings taken from the pilot or copilot seating systems (seat pad and seat pan locations) for that helicopter type.

Table 3
Percentage of acceptable WBV signatures

		UH-1		UH-60		
ADS-27 ISO			ISO	ADS	-27	ISO
	II	1BP		II	1BP	
				,		
Total	28%	19.79%	42.71%	61.50%	30.68%	59.10%
Pan	24%	20.83%	31.25%	57.69%	29.54%	50.00%
Pad	32%	18.75%	54.16%	65.38%	31.80%	68.20%
Co-P	12%	10.40%	8.30%	67.30%	29.50%	75.00%
P	44%	29.16%	77.08%	55.76%	31.80%	43.18%

Table 4 displays the average intrusion index for the UH-1 and UH-60 at all accelerometer positions.

Table 4
Average intrusion index

 Aircraft	Accelerometer location	Pilot/ copilot	Average intrusion index	
UH-60	Pad	CP	1.5200	
UH-60	Pan	CP	1.7440	
UH-60	Pad	P	1.4132	
UH-60	Pan	P	1.7900	
UH-1	 Pad	CP	2.434	
UH-1	Pan	CP	2.995	
UH-1	Pad	P	1.629	
UH-1	Pan	P	1.932	

Discussion

When studying the results of Table 3, consideration must be placed on the accelerometer location specified by each of the two standards. As previously mentioned, ADS-27 calls for the accelerometer to be located at the "seat pan," while ISO 2631 defines the "seat pad" as the proper accelerometer location for capturing WBV signatures. The vibrations that have been measured from the two specified locations will be of primary interest, especially when comparing the two standards.

Evaluation of the UH-60 WBV data

Based on the intrusion index and using specified "seat pan" accelerometer location, 57 percent of the signatures were judged as acceptable. The acceptability rate was reduced to 29 percent when the intrusion index and the 1BP criteria were combined to form the *1BP category. On the other hand, the acceptance rate of 68 percent was obtained when UH-60 "seat pad" vibration data was analyzed according to ISO 2631.

Evaluation of the UH-1 WBV data

Using the intrusion index alone as a criterion yielded a 24 percent passing rate. When the intrusion index and the 1BP criterion was used to assess the whole-body signatures, only 20 percent of the signatures were found acceptable. The ISO 2631 acceptance rate was 54 percent.

From this comparison alone, ADS-27 was seen to be the more stringent standard. Also, it is evident the combined criteria, *1BP, make ADS-27 the significantly more stringent WBV vibration standard.

Table 4 indicates the "average" intrusion index for the UH-60 and the UH-1 at the different accelerometer locations. Two conclusions can be drawn from this table: First, the UH-1 vibrates with a greater force than the UH-60 and second, when seat pad and seat pan accelerometer vibration data were analyzed according to intrusion index criterion, seat pan accelerometer output consistently yielded a greater average intrusion index.

The 1BP portion of the ADS-27 fix WBV acceptability levels for the 1BP passing frequency magnitudes in all three orthogonal directions (X-, Y-, Z-axes). 1BP frequency magnitudes are proportional to the mechanical vibration induced by a helicopter's main rotor during normal rotation. Variations of 1BP magnitude variations that occur among similar aircraft may be due to differences in systems tracking and levels of mainte-

nance. 1BP magnitude variations that occur in the same aircraft may be generated by the differences in flight regimen and a variety of pilot flight styles. Since the 1BP is an unstable measure of vibration in similar aircraft, and no correlation has been determined between 1BP magnitudes and intrusion index levels for nearly identical flight conditions, 1BP measures should not be used as a guide for indicating the vibration levels in specific type helicopters. 1BP measures serve to diagnose problems in rotor blade tracking and may indicate flight conditions with pronounced vibration magnitudes produced by the 1BP frequency. 1BP vibration magnitude peaks are found in that frequency range most sensitive for humans and, therefore, must not be ignored.

The ADS-27 standard specifies the seat pan as the primary location for accelerometer placement. The seat pan should not be considered a direct input of vibration to the pilot or copilot, for to do so would be to ignore the damping and amplifying effects of the seat cushsion. The seat pan is the prefiltered vibration that was transferred from the helicopter frame through the seat legs to the hard under-portion of the helicopter seat. Frequency transfer functions between the seat pan and the seat pad accelerometers indicate that helicopter frame vibration is amplified and/or attenuated over the frequency range of concern (1-80 Hz). Frequency responses between the seat pan and the seat pad should be a major consideration when analyzing input of vibration levels to a pilot.

The ADS-27 is primarily a rotary-wing aircraft design standard used for the purpose of issuing Requests for Proposal (RFP) and subsequent procurement specifications. The standard was modified to measure frame vibration in specific locations within the helicopter, specifically, vibration near pilot and crewmember locations. ADS-27 offers a method to quantify helicopter WBV and may be used to identify areas within the aircraft that introduce the greatest vibration magnitudes. ADS-27 derives its WBV numeric value (i.e., the intrusion index) from limitations on helicopter pilot and crewmember performance while it bypasses the health-related aspects of WBV.

The ISO 2631 recognizes the various elements (performance, comfort, fatigue, and health) as the essential ingredients in developing WBV assessment criteria. This standard has been criticized for the weak basis for the development of its health hazard criteria. At the time of ISO 2631's development, research data suggested in order for a human to "endure" longer exposures to vibrations without injury their levels must decrease. Furthermore, since the data was limited, extrapolations to longer durations were made using mathematical modeling and some fundamental assertions. However, most critics of ISO 2631 avoid the health element in their assessment of WBV.

Although data on vibration-induced injury may be scarce, inconclusive, and may be a weak basis for setting exposure limits for the purpose of making HHAs, the relationship between injury and WBV has been shown to exist and should be accounted for.

Conclusions

Both the ISO 2631 and ADS-27 have deficiences which are difficult but not impossible to overcome. ADS-27 is a statistical measure of mechanically-induced rotary-wing aircraft vibration. The method is based on the levels of vibration from the aircraft frame and yields a number value for this vibra-The ISO also uses vibration from the aircraft, but takes its level measurement from the man-machine interface location (i.e., the seat pad). The ADS-27 is derived primarily from pilot performance data and may be considered as a misplaced aircraft design standard which was modified to emulate a WBV standard much like the ISO 2631. When vibration levels are measured on a pass/fail criteria, the ADS-27 standard becomes the more stringent standard. But, ADS-27 fails to answer the important health hazard questions that ISO 2631 attempts. Until a more definitive and militarily-relevent WBV standard is developed, the use of both ISO 2631 and ADS-27 may be a more complete method of helicopter WBV analysis.

References

- Aeronautical Design Standard. 1986. Requirements for rotorcraft vibration specifications, modeling and testing. St. Louis, MO. U.S. Army Aviation Systems Command, Directorate for Engineering. ADS-27
- International Organization for Standardization. 1985.

 <u>Guide for the evaluation of human exposure to whole-body vibration</u>. ISO 2631-1985
- Kidd, David L. 1981. <u>Assessment of helicopter vibration</u>
 <u>criteria</u>. Fort Worth, TX. Bell Helicopter Textron.
 Presented at the American Helicopter Society 37th Annual
 Forum. New Orleans, LA.
- Oborne, D. J. 1983. Whole-Body Vibration and International Standard ISO 2631: A Critique. In: <u>Human Factors</u>. 25(1), 55-69.

Appendix

List of equipment manufacturers

Bruel & Kjaer Instruments, Inc. Forest Street
Marlborough, MA 01752

Hewlett-Packard Company 4700 Bayou Blvd, Suite 5 Pensacola, FL 32505

Kistler-Morse 10201 Willows Road, N.E. Redmond, WA 98073

Larson Davis Laboratories 280 S. Main Street Pleasant Grove, UT 84062

Lee Associates 815 Wheeler Avenue Huntsville, AL 35801

Initial distribution

Commander
U.S. Army Natick Research
and Development Center
ATTN: Documents Librarian
Natick, MA 01760

Naval Submarine Medical
Research Laboratory
Medical Library, Naval Sub Base
Box 900
Groton, CT 05340

Commander/Director
U.S. Army Combat Surveillance
& Target Acquisition Lab
ATTN: DELCS-D
Fort Monmouth, NJ 07703-5304

Commander
10th Medical Laboratory
ATTN: Audiologist
APO NEW YORK 09180

Commander
Naval Air Development Center
Biophysics Lab
ATTN: G. Kydd
Code 60B1
Warminster, PA 18974

Naval Air Development Center Technical Information Division Technical Support Detachment Warminster, PA 18974

Dr. E. Hendler Human Factors Applications, Inc. 295 West Street Road Warminster, PA 18974

Under Secretary of Defense for Research and Engineering ATTN: Military Assistant for Medical and Life Sciences Washington, DC 20301 Commander
U.S. Army Research Institute
of Environmental Medicine
Natick, MA 01760

U.S. Army Avionics Research and Development Activity ATTN: SAVAA-P-TP Fort Monmouth, NJ 07703-5401

U.S. Army Research and Development Support Activity Fort Monmouth, NJ 07703

Chief, Benet Weapons Laboratory LCWSL, USA ARRADCOM ATTN: DRDAR-LCB-TL Watervliet Arsenal, NY 12189

Commander
Man-Machine Integration System
Code 602
Naval Air Development Center
Warminster, PA 18974

Commander
Naval Air Development Center
ATTN: Code 6021 (Mr. Brindle)
Warminster, PA 18974

Commanding Officer
Naval Medical Research
and Development Command
National Naval Medical Center
Bethesda, MD 20014

Director Army Audiology and Speech Center Walter Reed Army Medical Center Washington, DC 20307-5001 COL Franklin H. Top, Jr., MD
Walter Reed Army Institute
of Research
Washington, DC 20307-5100

HQ DA (DASG-PSP-0)
Washington, DC 20310

Naval Research Laboratory Library Code 1433 Washington, DC 20375

Harry Diamond Laboratories
ATTN: Technical Information Branch
2800 Powder Mill Road
Adelphi, MD 20783-1197

U.S. Army Materiel Systems
Analysis Agency
ATTN: Reports Processing
Aberdeen proving Ground
MD 21005-5017

U.S. Army Ordnance Center and School Library Building 3071 Aberdeen Proving Ground, MD 21005-5201

U.S. Army Environmental Hygiene
Agency Laboratory
Building E2100
Aberdeen Proving Ground,
MD 21010

Technical Library
Chemical Research
and Development Center
Aberdeen Proving Ground,
MD 21010-5423

Commander
U.S. Army Institute
of Dental Research
Walter Reed Army Medical Center
Washington, DC 20307-5300

Naval Air Systems Command Technical Air Library 950D Rm 278, Jefferson Plaza II Department of the Navy Washington, DC 20361

Naval Research Laboratory Library Shock and Vibration Information Center, Code 5804 Washington, DC 20375

Director
U.S. Army Human Engineering Laboratory
ATTN: Technical Library
Aberdeen Proving Ground,
MD 21005-5001

Commander
U.S. Army Test
and Evaluation Command
ATTN: AMSTE-AD-H
Aberdeen Proving Ground,
MD 21005-5055

Director
U.S. Army Ballistic
Research Laboratory
ATTN: DRXBR-OD-ST Tech Reports
Aberdeen Proving Ground,
MD 21005-5066

Commander
U.S. Army Medical Research
Institute of Chemical Defense
ATTN: SGRD-UV-AO
Aberdeen Proving Ground,
MD 21010-5425

Commander
U.S. Army Medical Research
and Development Command
ATTN: SGRD-RMS (Ms. Madigan)
Fort Detrick, Frederick, MD 21701

Commander
U.S. Army Medical Research
Institute of Infectious Diseases
Fort Detrick, Frederick,
MD 21701

Director, Biological
Sciences Division
Office of Naval Research
600 North Quincy Street
Arlington, VA 22217

Commander
U.S. Army Materiel Command
ATTN: AMCDE-S (CPT Broadwater)
5001 Eisenhower Avenue
Alexandria, VA 22333

Commandant
U.S. Army Aviation
Logistics School
ATTN: ATSQ-TDN
Fort Eustis, VA 23604

U.S. Army Training
 and Doctrine Command
ATTN: ATCD-ZX
Fort Monroe, VA 23651

Structures Laboratory Library
USARTL-AVSCOM
NASA Langley Research Center
Mail Stop 266
Hampton, VA 23665

Naval Aerospace Medical Institute Library Bldg 1953, Code 102 Pensacola, FL 32508

Command Surgeon
U.S. Central Command
MacDill Air Force Base
FL 33608

Air University Library (AUL/LSE)
Maxwell AFB, AL 36112

Commander
U.S. Army Medical Bioengineering
Research and Development Lab
ATTN: SGRD-UBZ-I
Fort Detrick, Frederick,
MD 21701

Defense Technical Information Center Cameron Station Alexandria, VA 22313

U.S. Army Foreign Science
 and Technology Center
ATTN: MTZ
220 7th Street, NE
Charlottesville, VA 22901-5396

Director,
Applied Technology Laboratory
USARTL-AVSCOM
ATTN: Library, Building 401
Fort Eustis, VA 23604

U.S. Army Training
and Doctrine Command
ATTN: Surgeon
Fort Monroe, VA 23651-5000

Aviation Medicine Clinic TMC #22, SAAF Fort Bragg, NC 28305

U.S. Air Force Armament
Development and Test Center
Eglin Air Force Base, FL 32542

U.S. Army Missile Command
Redstone Scientific
Information Center
ATTN: Documents Section
Redstone Arsenal, AL 35898-5241

U.S. Army Research and Technology Labortories (AVSCOM) Propulsion Laboratory MS 302-2 NASA Lewis Research Center Cleveland, OH 44135 AFAMRL/HEX Wright-Patterson AFB, OH 45433

University of Michigan
NASA Center of Excellence
in Man-Systems Research
ATTN: R. G. Snyder, Director
Ann Arbor, MI 48109

John A. Dellinger, MS, ATP University of Illinois-Willard Airport Savoy, IL 61874

Project Officer
Aviation Life Support Equipment
ATTN: AMCPO-ALSE
4300 Goodfellow Blvd.
St. Louis, MO 63120-1798

Commander
U.S. Army Aviation
 Aviation Systems Command
ATTN: DRSAV-ED
4300 Goodfellow Blvd
St. Louis, MO 63120

Commanding Officer
Naval Biodynamics Laboratory
P.O. Box 24907
New Orleans, LA 70189

U.S. Army Field Artillery School ATTN: Library Snow Hall, Room 14 Fort Sill, OK 73503

Commander
U.S. Army Health Services Command
ATTN: HSOP-SO
Fort Sam Houston, TX 78234-6000

U.S. Air Force Institute
of Technology (AFIT/LDEE)
Building 640, Area B
Wright-Patterson AFB, OH 45433

Henry L. Taylor
Director, Institute of Aviation
University of IllinoisWillard Airport
Savoy, IL 61874

Commander
U.S. Army Aviation
Systems Command
ATTN: DRSAV-WS
4300 Goodfellow Blvd
St. Louis, MO 63120-1798

Commander
U.S. Army Aviation
Systems Command
ATTN: SGRD-UAX-AL (MAJ Lacy)
4300 Goodfellow Blvd., Bldg 105
St. Louis, MO 63120

U.S. Army Aviation
Systems Command
Library and Information
Center Branch
ATTN: DRSAV-DIL
4300 Goodfellow Blvd
St. Louis, MO 63120

Federal Aviation Administration Civil Aeromedical Institute CAMI Library AAC 64D1 P.O. Box 25082 Oklahoma City, OK 73125

Commander
U.S. Army Academy
of Health Sciences
ATTN: Library
Fort Sam Houston, TX 78234

Commander
U.S. Army Institute
of Surgical Research
ATTN: SGRD-USM (Jan Duke)
Fort Sam Houston, TX 78234-6200

Director of Professional Services AFMSC/GSP Brooks Air Force Base, TX 78235

U.S. Army Dugway Proving Ground Dr. Diane Damos Technical Library 3Bldg 5330 Dugway, UT 84022

U.S. Army Yuma Proving Ground Technical Library Technical Library Yuma, AZ 85364

AFFTC Technical Library 6520 TESTG/ENXL Edwards Air Force Base, CAL 93523-5000

Commander Code 3431 Naval Weapons Center China Lake, CA 93555

Aeromechanics Laboratory U.S. Army Research and Technical Labs Ames Research Center, M/S 215-1 Moffett Field, CA 94035

Sixth U.S. Army ATTN: SMA Presidio of San Francisco, CA 94129

Commander U.S. Army Aeromedical Center Fort Rucker, AL 36362

Directorate of Combat Developments Bldg 507 Fort Rucker, AL 36362

U.S. Air Force School of Aerospace Medicine Strughold Aeromedical Library Documents Section, USAFSAM/TSK-4 Brooks Air Force Base, TX 78235

Department of Human Factors ISSM, USC Los Angeles, CA 90089-0021

U.S. Army White Sands Missile Range Technical Library Division White Sands Missile Range, NM 88002

U.S. Army Aviation Engineering Flight Activity ATTN: SAVTE-M (Tech Lib) Stop 217 Edwards Air Force Base, CA 93523-5000

U.S. Army Combat Developments Experimental Center Technical Information Center Bldq 2925 Fort Ord, CA 93941-5000

Commander Letterman Army Institute of Research
ATTN: Medical Research Library of Research Presidio of San Francisco, CA 94129

Director Naval Biosciences Laboratory Naval Supply Center, Bldg 844 Oakland, CA 94625

Commander U.S. Army Aviation Center and Fort Rucker ATTN: ATZQ-CDR Fort Rucker, AL 36362

Directorate of Training Development Bldq 502 Fort Rucker, AL 36362

Chief Army Research Institute Field Unit Fort Rucker, AL 36362

Commander
U.S. Army Safety Center
Fort Rucker, AL 36362

U.S. Army Aircraft Development
Test Activity
ATTN: STEBG-MP-QA
Cairns AAF
Fort Rucker, AL 36362

Chief Human Engineering Laboratory Field Unit Fort Rucker, AL 36362

Commander
U.S. Army Aviation Center
and Fort Rucker
ATTN: ATZQ-T-ATL
Fort Rucker, AL 36362

President U.S. Army Aviation Board Cairns AAF Fort Rucker, AL 36362